

SERVICE BULLETIN ML 0004



Date : Friday, February 19, 1999
Game : Ripper Ribbit
Subject : Power fused on neutral line

Distribution List

Australasia : - LAI WA, SA, VIC, NSW & QLD - Sales, Operations, Service Departments
- LAI Games, NZ Coin Cascade, webmaster@lai.com.au
Asia : - ML Prod, ML Sales, MGF Operations, MGF Service, Philippines
- LAI Asia Sales, Operations & Service

Problem : Power Distribution Box fused on neutral line

Solution : Remove DB box from machine and inspect for fuse in neutral line (See Figure 1). If this is the case follow the instructions listed below.


Parts Needed : 1 X 6.8mm Quick Connect terminal
1 X 5mm Quick Connect terminal

1. Remove Blue wire line-in on Noise Filter (going to fuse holder) and connect it to lower pole of Power Switch.
2. Take the Brown wire that you removed from the lower switch pole and cut of 6.8mm Quick Connect terminal. (Saving Plastic Insulating sleeve for step 5)
3. Remove the other Blue wire from Fuse holder coming from Power input socket and cut off 5mm Quick Connect terminal. (Saving Plastic Insulating sleeve for step 4)
4. Crimp to the brown wire in step 2 a new 5mm Quick Connect terminal and connect to fuse holder.
5. Crimp to the Blue from the Power input socket a new 6.8mm Quick Connect terminal and connect to the Line-in on the Noise Filter
6. Inspect that all new Joints are correct (See Figure 2) and reinstall DB box into machine

Figure 1 Before



Figure 2 After

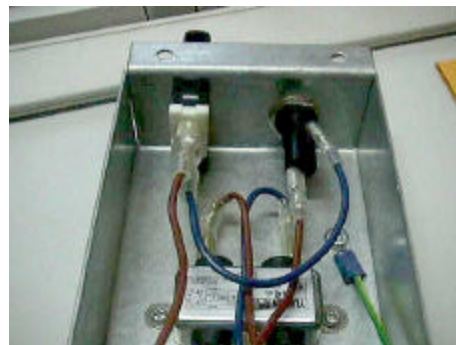

Regards

Matahari Leisure