

SERVICE BULLETIN ML 0009



Date : 05 August, 1999
Game : Stop The Clock (Ticket)
Subject : Static "Zapping" Problems

Distribution List

Australasia : - LAI WA, SA, VIC, NSW & QLD - Sales, Operations, Service Departments
- LAI Games, NZ Coin Cascade, webmaster@lai.com.au
Asia : - ML Prod, ML Sales, MGF Operations, MGF Service, Philippines
- LAI Asia Sales, Operations & Service

Problem : Static Zapping of Coin and Ticket door may cause erratic operation of game and ticket dispenser.

Solution : Fit Earth wire from Ticket Dispenser bracket directly to the Power Distribution Box. This can be made from 1mm² Wire or Brad of 1.5m in length. Attach one end to one or more of the Ticket Dispenser bracket Bolts (See Photo 1) and the other end on the Power Distribution Box earth binding post (See Photo 2). This part can be made available at your closest LAI Games Distributor.

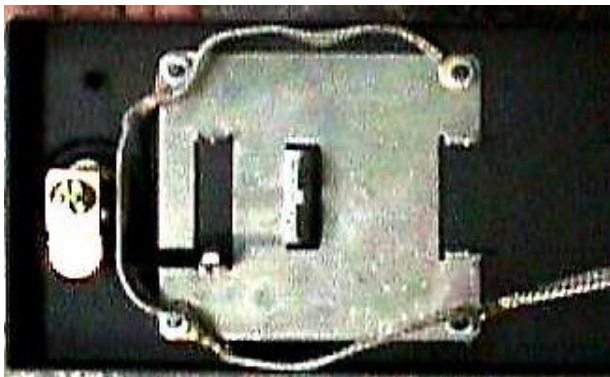


Photo 1



Photo 2

Regards

Matahari Leisure