

# SERVICE BULLETIN ML 0021



Date : 05 December, 2000  
Game : Ticket Factory  
Subject : CPU constantly resetting


---

Distribution List :- [info@lai.com.au](mailto:info@lai.com.au); [techforum@lai.com.au](mailto:techforum@lai.com.au); [www.lai.com](http://www.lai.com)  
LAI Games :- Australia, New Zealand, Singapore and USA  
Timezone FEC :- Australia, India, Indonesia, New Zealand, Philippines and Singapore

---

**Problem** : Game CPU Board is constantly resetting or not powering up and the power LED on both the Game CPU Board and +5V Regulator Board are pulsing. +5V from the Regulator Board is missing and the Game CPU Board is receiving a pulsing +5V supply from the Wheel Sensor Board.

**Solution** : Check the +5V Regulator Board fuse to see if it is blown or that the Regulator IC 7805 is faulty and replace as needed.

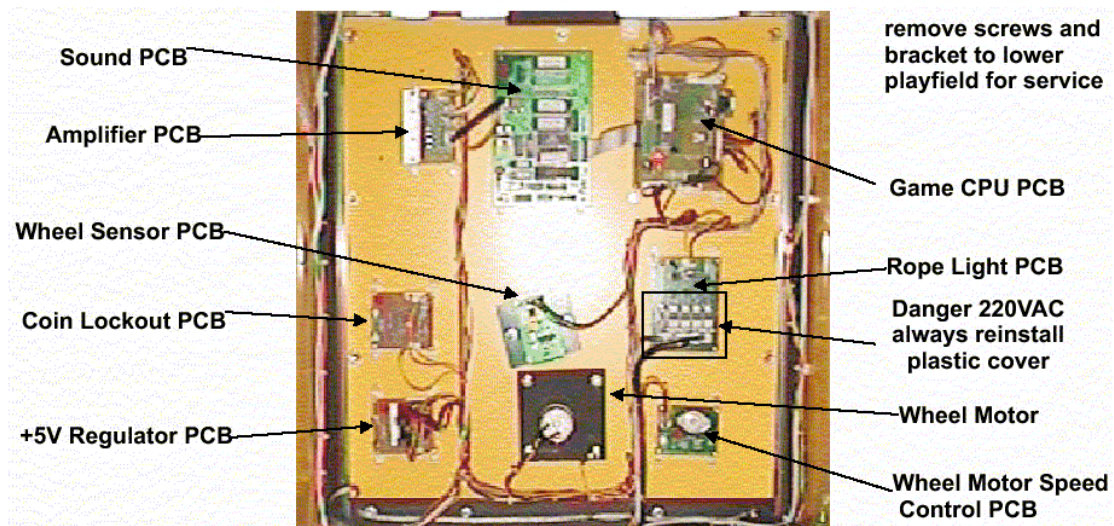

Regards

**LAI Games**