



Rear Seat-Back Lock Is Hard to Turn

SYMPTOM

The rear seat-back lock is hard to turn, or it won't turn at all.

PROBABLE CAUSE

The left lock rod is too long.

CORRECTIVE ACTION

Replace the lock rod.

VEHICLES AFFECTED

2001 Civic 2-Door – ALL

2002 Civic 2-Door

KX: From VIN 1HGEM2...2L900001 thru
VIN 1HGEM2...2L900011

KG: From VIN 1HGEM2...2L600001 thru
VIN 1HGEM2...2L600330

KE: From VIN 1HGEM2...2L600001 thru
VIN 1HGEM2...2L600024

PARTS INFORMATION

Lock Rod: P/N 82620-S5P-999, H/C 6597660

WARRANTY CLAIM INFORMATION

In warranty: The normal warranty applies.

Operation Number: 853103

Flat Rate Time: 0.2 hour


Failed Part: P/N 82620-S5P-A01
H/C 6597660

Defect Code: 030

Contention Code: B01

REPAIR PROCEDURE

1. Open the trunk.
2. Pull the left rear seat handle to release the seat-back.
3. Rotate the lock rod clip; remove and discard the lock rod.

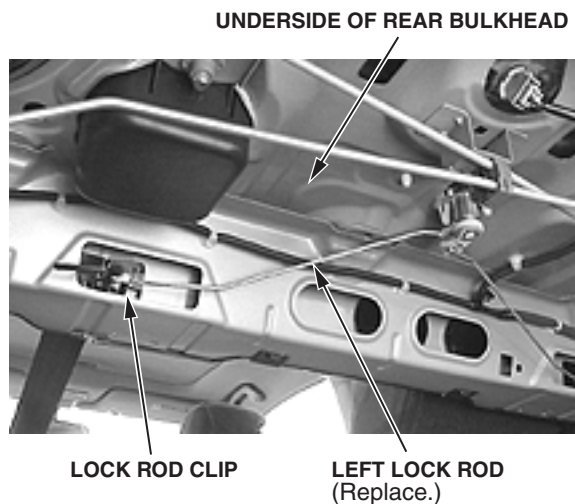

4. Install the new lock rod.
5. Reinstall the lock rod clip.
6. Lock and unlock the seat-back three or four times to make sure the lock works well.