

SERVICE BULLETIN ML 0008



Date : 05 August, 1999
Game : All Games
Subject : Possible Floating Logic Ground

Distribution List


Australasia : - LAI WA, SA, VIC, NSW & QLD - Sales, Operations, Service Departments
- LAI Games, NZ Coin Cascade, webmaster@lai.com.au
Asia : - ML Prod, ML Sales, MGF Operations, MGF Service, Philippines
- LAI Asia Sales, Operations & Service

Problem

: It is possible that the Logic Ground from the Switch Mode Power Supply can have a floating voltage above the earth line. This can result in electric shocks to service personnel handling components powered by the Switch Mode Power Supply while the machine is On. It can also cause static related problems to the Logic Boards.

Solution

: To eliminate this possibility, the Earth (FG) and Logic Ground (GND) on the Switch Mode Power Supply must be jumpered together. (See Photo) The Jumper is about 5cm of 0.75mm with screw post connectors at each end. This part can be made available at your closest LAI Games Distributor.

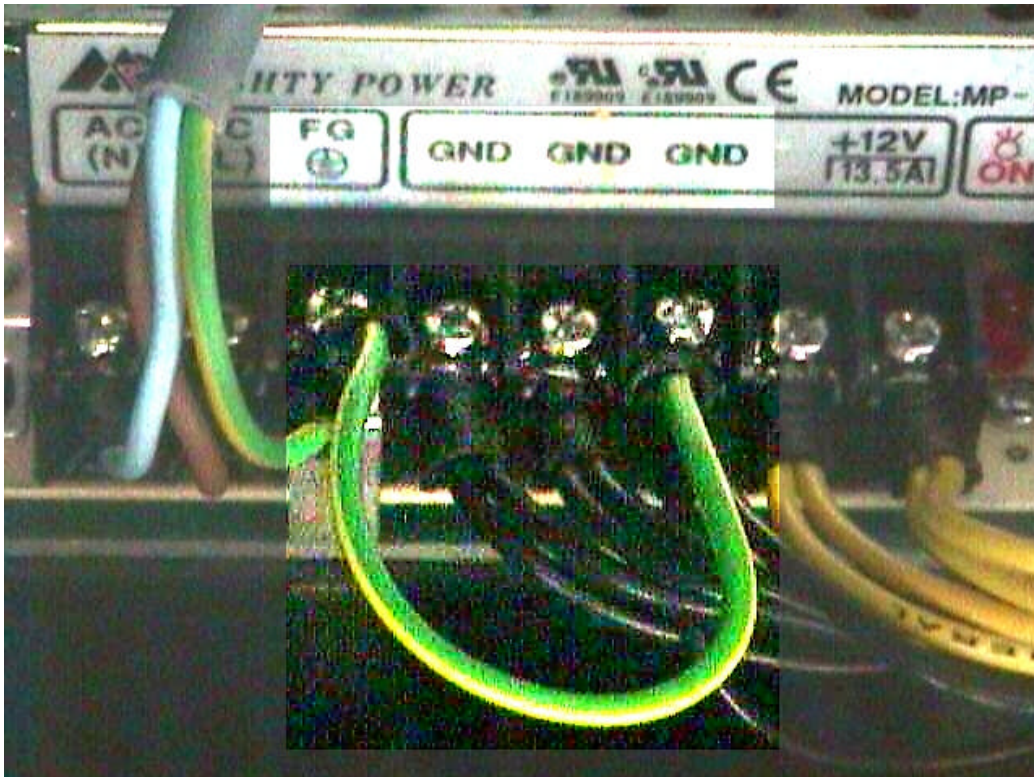

Regards

Matahari Leisure